

# S108T01/S108T02 S208T01/S208T02

## Low Profile Type Solid State Relays

### ■ Features

1. Low profile type (height : 16mm)
2. Built-in zero-cross circuit (**S108T02/S208T02**)
3. RMS ON-state current  $I_r$  : MAX. 8Arms
4. Approved by TÜV, No. R9750791 (**S208TY1/S208TY2**)  
Input-Output : Basic Insulation

### ■ Applications

1. Programmable controllers
2. Air conditioners
3. Copiers
4. Automatic vending machines

### ■ Model line-ups

	For 100V lines	For 200V lines
No zero-cross circuit	<b>S108T01</b>	<b>S208T01</b>
Built-in zero-cross circuit	<b>S108T02</b>	<b>S208T02</b>

### ■ Absolute Maximum Ratings

( $T_a=25^{\circ}\text{C}$ )

Parameter		Symbol	Rating	Unit	
Input	Forward current	$I_F$	50	mA	
	Reverse voltage	$V_R$	6	V	
	RMS ON-state current	$I_r$	*1 8	A <sub>rms</sub>	
	*2 Peak one cycle surge current	$I_{\text{surge}}$	80	A	
Output	Repetitive peak OFF-state voltage	$V_{\text{DRM}}$	<b>S108T01</b> <b>S108T02</b>	400	V
			<b>S208T01</b> <b>S208T02</b>	600	
	Non-repetitive peak OFF-state voltage	$V_{\text{DSM}}$	<b>S108T01</b> <b>S108T02</b>	400	V
			<b>S208T01</b> <b>S208T02</b>	600	
	Critical rate of rise of ON-state current	$dI_r/dt$	50	A/ $\mu\text{s}$	
	Operating frequency	$f$	45 to 65	Hz	
Operating temperature	$T_{\text{opr}}$	-25 to +100	$^{\circ}\text{C}$		
Storage temperature	$T_{\text{stg}}$	-30 to +125	$^{\circ}\text{C}$		
*3 Isolation voltage	$V_{\text{iso}}$	3.0	kV <sub>rms</sub>		
*4 Soldering temperature	$T_{\text{sol}}$	260	$^{\circ}\text{C}$		

\*1 Refer to Fig.2, Fig.3

\*2 60Hz sine wave, start at  $T_j=25^{\circ}\text{C}$

\*3 Isolation voltage measuring method


- (1) Dielectric withstand voltage tester with zero cross circuit shall be used.
- (2) The applied voltage waveform shall be sine wave.
- (3) Voltage shall be applied between input and output.  
(Input and output terminals shall be shorted respectively.)

(4) AC 60Hz, 1min, 40 to 60%RH.

\*4 For 10s

### ■ Outline Dimensions

(Unit : mm)

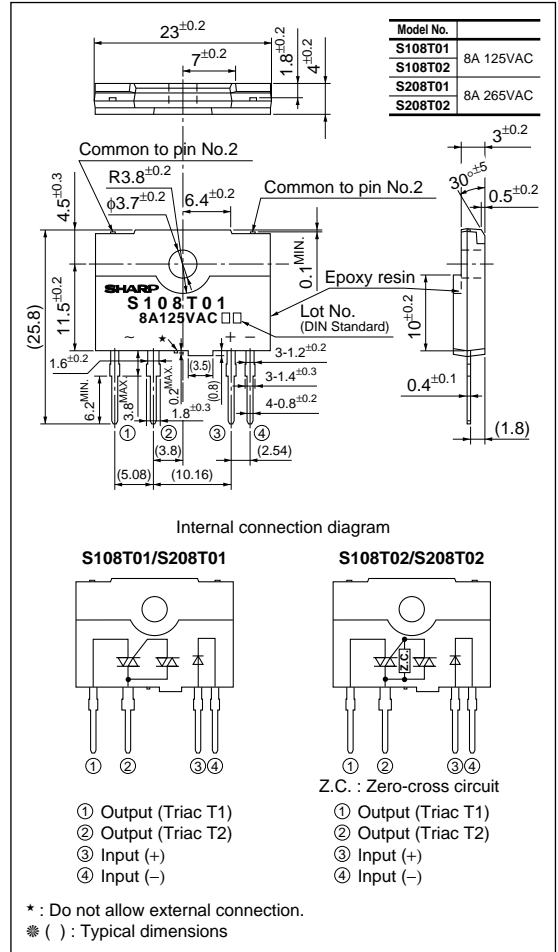


■ Electrical Characteristics


(Ta=25°C)

Parameter		Symbol	Conditions	MIN.	TYP.	MAX.	Unit	
Input	Forward voltage	$V_F$	$I_F=20\text{mA}$	-	1.2	1.4	V	
	Reverse current	$I_R$	$V_R=3\text{V}$	-	-	$1 \times 10^{-4}$	A	
	Repetitive peak OFF-state current	$I_{DRM}$	$V_D=V_{DRM}$	-	-	$1 \times 10^{-4}$	A	
Output	ON-state voltage	$V_T$	$I_T=2A_{rms}$ , Resistance load, $I_F=20\text{mA}$	-	-	1.5	$V_{rms}$	
	Holding current	$I_H$	-	-	-	50	mA	
	Critical rate of rise of OFF-state voltage	$dV/dt$	$V_D=2/3V_{DRM}$	30	-	-	$V/\mu\text{s}$	
	Critical rate of rise of OFF-state voltage at commutation	$(dV/dt)_C$	$T_j=125^\circ\text{C}$ , $V_D=2/3V_{DRM}$ , $dI/dt=-4\text{A/ms}$	5	-	-	$V/\mu\text{s}$	
Transfer characteristics	Minimum trigger current	S108T01/S208T01	$V_D=12\text{V}$ , $R_L=30\Omega$	-	-	8	mA	
		S108T02/S208T02						$V_D=6\text{V}$ , $R_L=30\Omega$
	Zero cross voltage	S108T02/S208T02	$V_{OX}$	$I_F=8\text{mA}$	-	-	35	V
	Isolation resistance		$R_{iso}$	DC500V, 40 to 60%RH	$1 \times 10^{10}$	-	-	$\Omega$
	Turn-on time	S108T01	$t_{on}$	$V_D=100V_{rms}$ , AC50Hz, $I_T=2A_{rms}$ , Resistance load, $I_F=20\text{mA}$	-	-	1	ms
		S208T01						
		S108T02						
	S208T02	$V_D=200V_{rms}$ , AC50Hz, $I_T=2A_{rms}$ , Resistance load, $I_F=20\text{mA}$	10					
Turn-off time	S108T01	$t_{off}$	$V_D=100V_{rms}$ , AC50Hz, $I_T=2A_{rms}$ , Resistance load, $I_F=20\text{mA}$	-	-	10	ms	
	S108T02							
	S208T01							
S208T02	$V_D=200V_{rms}$ , AC50Hz, $I_T=2A_{rms}$ , Resistance load, $I_F=20\text{mA}$							
Thermal resistance (Between junction and case)		$R_{th(j-c)}$	-	-	4.5	-	$^\circ\text{C/W}$	
Thermal resistance (Between junction and ambience)		$R_{th(j-a)}$	-	-	40	-		

Fig.1 Forward Current vs. Ambient Temperature

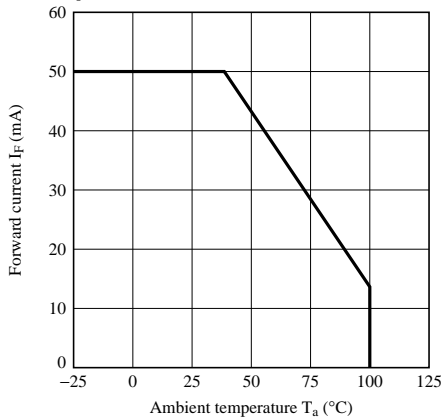


**Fig.2 RMS ON-state Current vs. Ambient Temperature**

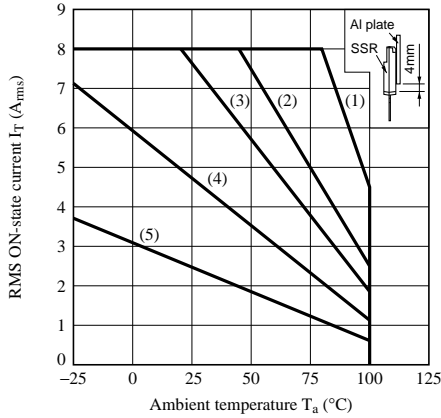


- (1) With infinite heat sink
  - (2) With heat sink (200×200×2mm Al plate)
  - (3) With heat sink (100×100×2mm Al plate)
  - (4) With heat sink (50×50×2mm Al plate)
  - (5) Without heat sink
- (Note) With the Al heat sink set up vertically, tighten the device with a torque of 0.4N•m and apply thermal conductive silicone grease on the mounting face of heat sink. Forced cooling shall not be carried out. (Please use an isolation sheet if necessary.)


**Fig.3 RMS ON-state Current vs. Case Temperature**

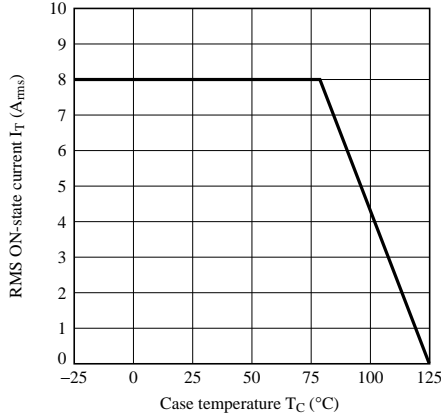


**Fig.4 Forward Current vs. Forward Voltage**

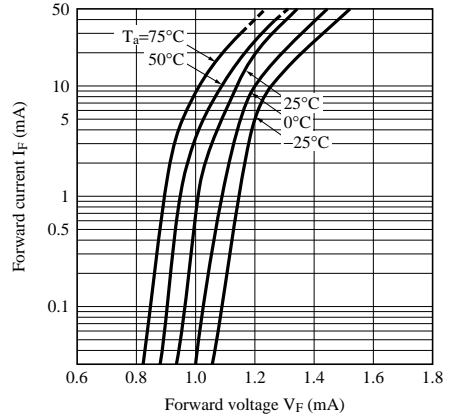


**Fig.5 Surge Current vs. Power-on Cycle**

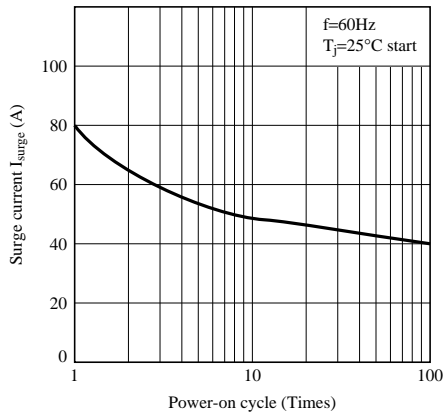


**Fig.6 Minimum Trigger Current vs. Ambient Temperature (Typical Value)**

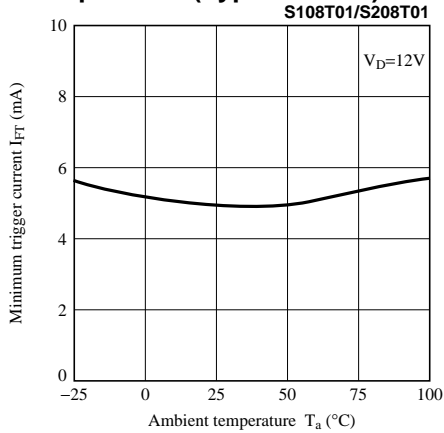


**Fig.7 Minimum Trigger Current vs. Ambient Temperature (Typical Value)**

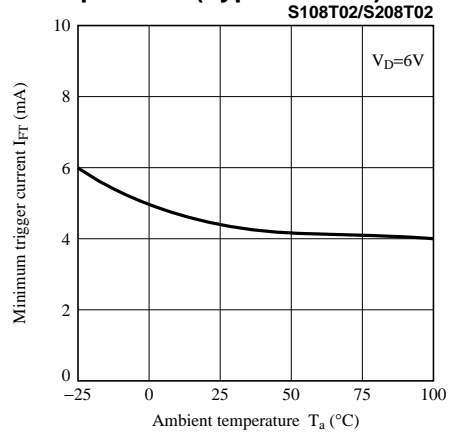


**Fig.8 Maximum ON-state Power Dissipation vs. RMS ON-state Current (Typical Value)**

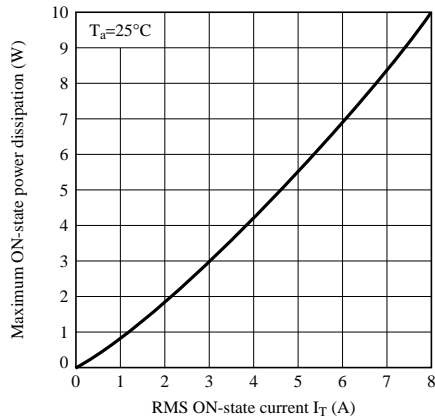

**Fig.9 Repetitive Peak OFF-state Current vs. Ambient Temperature**

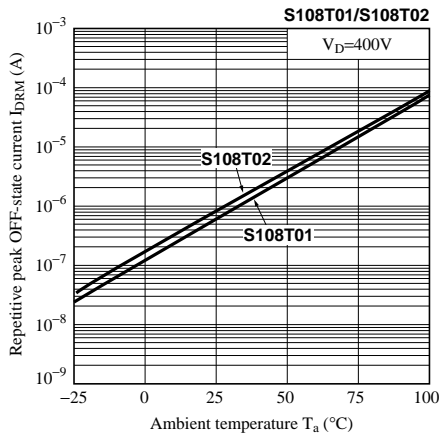

**Fig.10 Repetitive Peak OFF-state Current vs. Ambient Temperature**

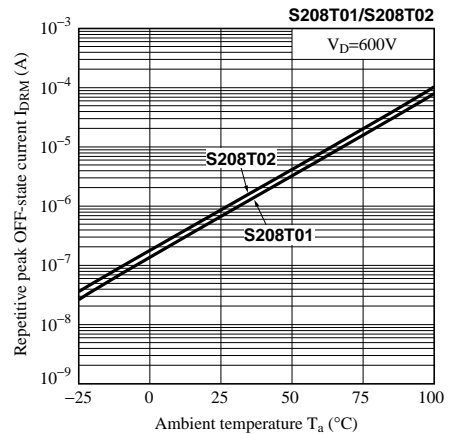

### NOTICE

- The circuit application examples in this publication are provided to explain representative applications of SHARP devices and are not intended to guarantee any circuit design or license any intellectual property rights. SHARP takes no responsibility for any problems related to any intellectual property right of a third party resulting from the use of SHARP's devices.
- Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device. SHARP reserves the right to make changes in the specifications, characteristics, data, materials, structure, and other contents described herein at any time without notice in order to improve design or reliability. Manufacturing locations are also subject to change without notice.
- Observe the following points when using any devices in this publication. SHARP takes no responsibility for damage caused by improper use of the devices which does not meet the conditions and absolute maximum ratings to be used specified in the relevant specification sheet nor meet the following conditions:
  - (i) The devices in this publication are designed for use in general electronic equipment designs such as:
    - Personal computers
    - Office automation equipment
    - Telecommunication equipment [terminal]
    - Test and measurement equipment
    - Industrial control
    - Audio visual equipment
    - Consumer electronics
  - (ii) Measures such as fail-safe function and redundant design should be taken to ensure reliability and safety when SHARP devices are used for or in connection with equipment that requires higher reliability such as:
    - Transportation control and safety equipment (i.e., aircraft, trains, automobiles, etc.)
    - Traffic signals
    - Gas leakage sensor breakers
    - Alarm equipment
    - Various safety devices, etc.
  - (iii) SHARP devices shall not be used for or in connection with equipment that requires an extremely high level of reliability and safety such as:
    - Space applications
    - Telecommunication equipment [trunk lines]
    - Nuclear power control equipment
    - Medical and other life support equipment (e.g., scuba).
- Contact a SHARP representative in advance when intending to use SHARP devices for any "specific" applications other than those recommended by SHARP or when it is unclear which category mentioned above controls the intended use.
- If the SHARP devices listed in this publication fall within the scope of strategic products described in the Foreign Exchange and Foreign Trade Control Law of Japan, it is necessary to obtain approval to export such SHARP devices.
- This publication is the proprietary product of SHARP and is copyrighted, with all rights reserved. Under the copyright laws, no part of this publication may be reproduced or transmitted in any form or by any means, electronic or mechanical, for any purpose, in whole or in part, without the express written permission of SHARP. Express written permission is also required before any use of this publication may be made by a third party.
- Contact and consult with a SHARP representative if there are any questions about the contents of this publication.